


UTL

INSTRUCTION MANUAL

UTL260

Digital Clamp-On Meter

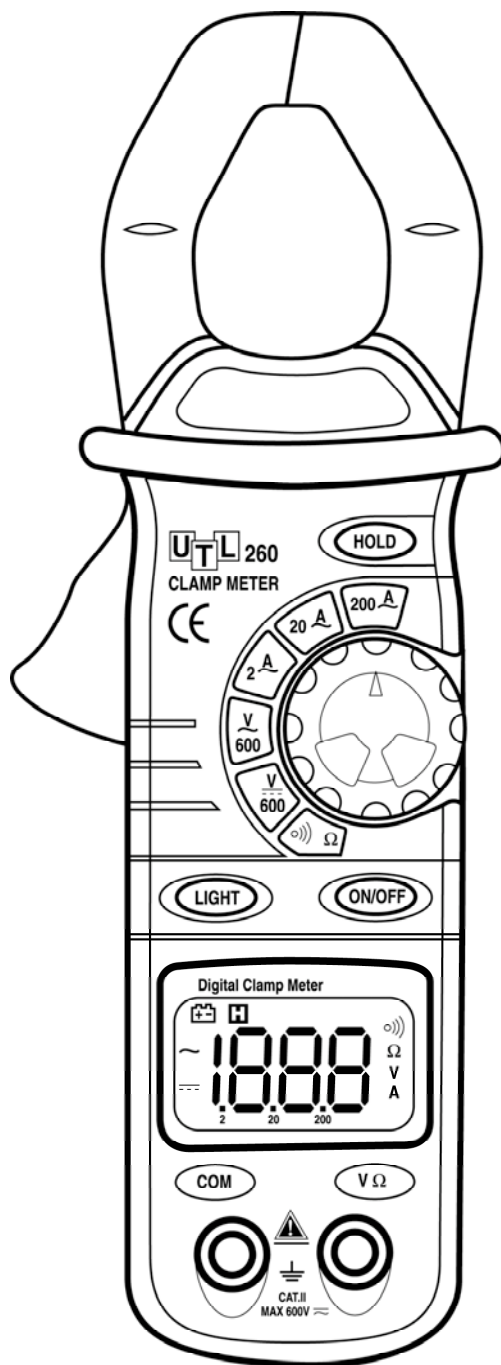

1-800-547-5740 • Fax: (503) 643-6322
www.ueitest.com • email: info@ueitest.com

Introduction

The UTL260 has all the features and measurement functions that appliance technicians need. It's ruggedized and slim compact design makes for easy one handed use.

Features include

- AC current 2A/20A/200A
- AC/DC voltage 600V
- Resistance 2k Ω
- Audible continuity
- LCD display with MAX reading 1999
- Automatic indication of functions and symbols
- Sample rate: 2 times/sec for digital data
- Backlit display for use in low light application

Safety Notes

Before using this meter, read all safety information carefully. In this manual the word "**WARNING**" is used to indicate conditions or actions that may pose physical hazards to the user. The word "**CAUTION**" is used to indicate conditions or actions that may damage this instrument.



WARNING!

Exceeding the specified limits of this meter is dangerous and can expose the user to serious or possibly fatal injury.

- **DO NOT** attempt to measure any voltage that exceeds 600 volts with this meter - UEi offers numerous alternatives for measuring high voltage and current
- Voltages above 60 volts DC or 30 volts AC may constitute a serious shock hazard
- **DO NOT** attempt to use this meter if either the meter or the test leads have been damaged. Send unit in for repair by a qualified repair facility
- Test leads must be fully inserted prior to taking measurements
- Always turn off power to a circuit (or assembly) under test before cutting, unsoldering or breaking the current path. Even small amounts of current can be dangerous
- Always disconnect the live test lead before disconnecting the common test lead from a circuit
- When measuring high voltage, disconnect the power source before making test lead connections. Connect the test leads to the meter first then to the circuit under test. Reapply power
- If any of the following indications occur during testing, turn off the power source to the circuit under test:
 - Arcing
 - Flame
 - Smoke
 - Extreme Heat
 - Smell of Burning Materials
 - Discoloration or Melting of Components


- Read the safety precautions associated with the equipment being tested and seek assistance or advice when performing unfamiliar tasks.
- Keep your fingers away from the test lead metal probe contacts and bus-bars when making measurements. Always grip the instrument and test-leads behind the hand guards (molded into the probes).
- In the event of electrical shock, ALWAYS bring the victim to the emergency room for evaluation, regardless of the victim's apparent recovery. Electrical shock can cause an unstable heart rhythm that may need medical attention.

International Symbols

Dangerous Voltage	Ground
AC Alternating Current	Warning or Caution
DC Direct Current	Double Insulation (Protection Class II)
Either AC or DC	Fuse
Not Applicable to Identified Model	Battery


Controls and Indicators

1. Transformer jaws
2. Protection ring
3. Jaw opening trigger
4. Light key
5. LCD display
6. COM terminal
7. V Ω terminal
8. Power key
9. Rotaryswitch
10. Hold key

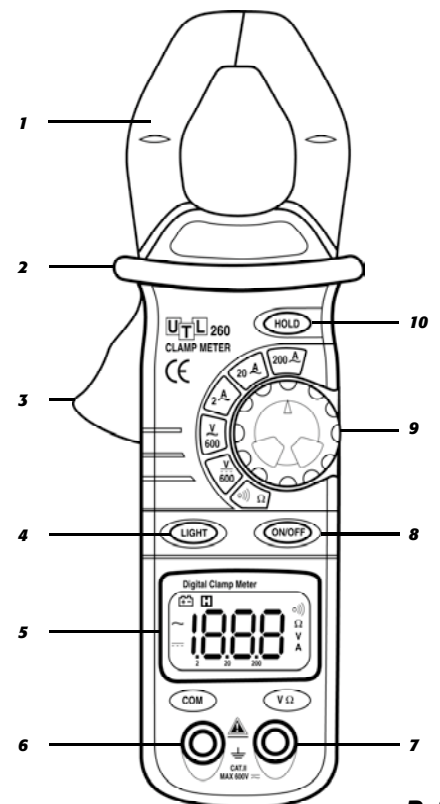


LCD Display Functional Description

1. Low battery indication
2. Hold data indication
3. Continuity function indication
4. Ohm measurement indication
5. Voltage measurement indication
6. Current measurement indication
7. DC input indication
8. AC input indication
9. Polarity indication

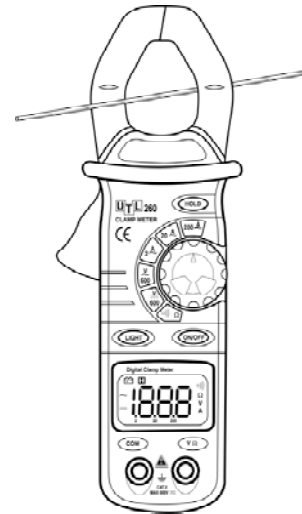

(Fig 1)

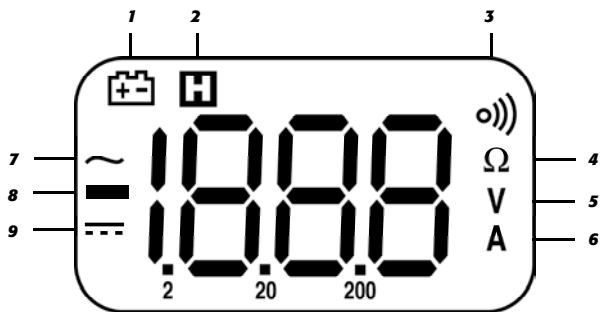

Operating Instructions

If the current under measurement is higher than the selected value for a long period, overheating may take place, compromising the safety and operation of inner circuits.



WARNING!

DO NOT measure currents on high-voltage conductors (>600V) to avoid risk of discharge and/or incorrect readings.

AC Current Measurement



WARNING!

Make certain that all test leads are disconnected from the meter terminals.

1. Set the rotary switch to the desired A~ range.
2. Clamp the current transducer (jaw) around one of the conductors under test. Make sure that the clamp jaw is closed (Fig 1).
3. Read the display value.
4. When only the figure "1" is displayed, it indicates over-range situation and the higher range has to be selected.


DC Voltage Measurement



WARNING!

Maximum input voltage of DC V range is 600V DC. Do not attempt to take any voltage measurement that exceeds 600V DC to avoid electrical shock and/or damage to the instrument.

1. Set the rotary switch to the 600V "===" range.
2. Connect the black and red test leads to the "COM" and "VΩ" terminals respectively.
3. Connect the test leads to the circuit being measured and read the displayed value (Fig 2).

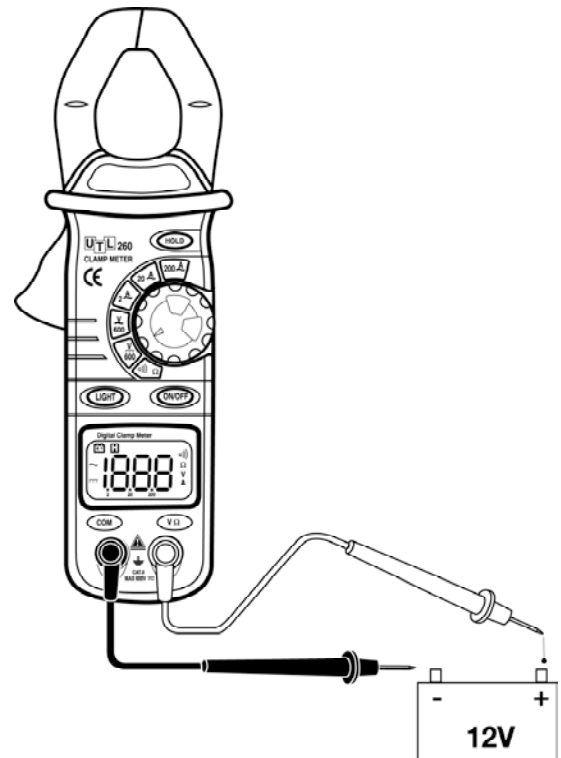

(Fig 2)


AC Voltage Measurement



WARNING!

Maximum input voltage of AC V range is 600Vrms. Do not attempt to take any voltage measurement that exceeds 600Vrms to avoid electrical shock hazard and/or damage to the instrument.

1. Set the rotary switch to the 600V~ range.
2. Connect the black and red test leads to the "COM" and "VΩ" terminals respectively.
3. Connect the test leads to the circuit being measured and read the displayed value (Fig 3).

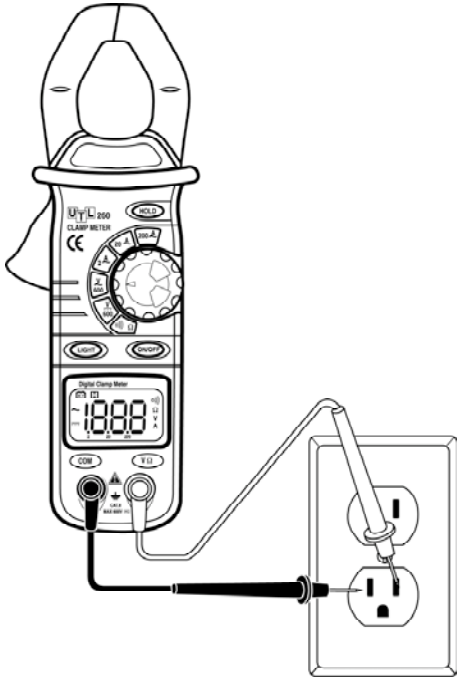

(Fig 3)


Resistance Measurement



WARNING!

Before taking any in-circuit resistance measurements, remove power from the circuit being tested and discharge all capacitors.

1. Set the rotary switch to the 600V~ range.
2. Connect the black and red test leads to the "COM" and "VΩ" terminals respectively.
3. Connect the test leads to the circuit being measured and read the displayed value (Fig 4).

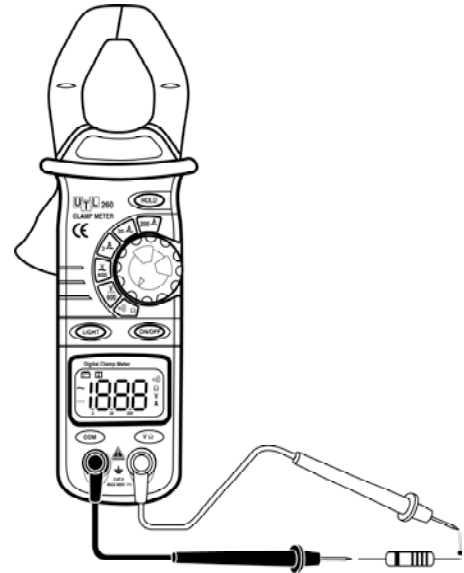

(Fig 4)

Continuity Measurement





WARNING!

Before taking any in-circuit resistance measurements, remove power from the circuit being tested and discharge all capacitors.

1. Set the rotary switch to "•••) Ω" range.
2. Connect the black and red test leads to the "COM" and "VΩ" terminals respectively.
3. Connect the test leads to the resistance in the circuit being measured (Fig 5).
4. When the test lead to the circuit is below 50Ω, it will be indicated by a continuous beeping.

NOTE: Continuity test is available to check open/short of the circuit.

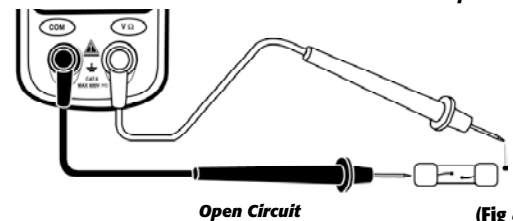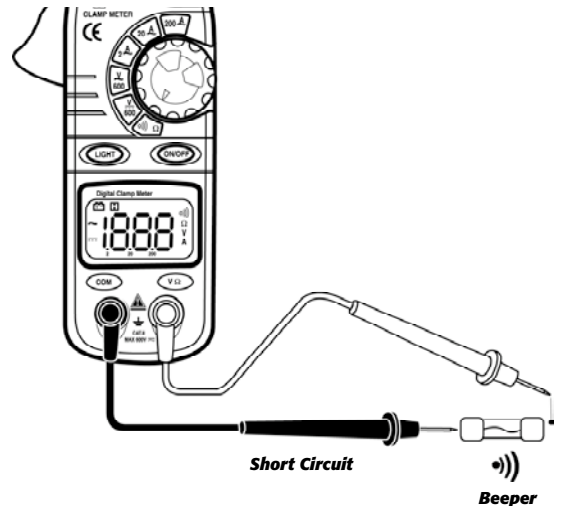

(Fig 4)

Maintenance

Periodic service



WARNING!

Repair and service of this instrument is to be performed by qualified personnel only. Improper repair or service could result in physical degradation of the meter. This could alter the protection from electrical shock and personal injury this meter provides to the operator. Perform only those maintenance tasks that you are qualified to do.

These guidelines will help you attain long and reliable service from your meter:

1. Calibrate your meter annually to ensure it meets original performance specifications.
2. Keep your meter dry. If it gets wet, wipe it dry immediately. Liquids damage electronic circuits.
3. Whenever practical, keep the meter away from dust and dirt, which can cause premature wear.
4. Although your meter is built to withstand the rigors of daily use, it can be damaged by severe impacts. Use reasonable caution when using and storing the meter.

Cleaning and Decontamination

Periodically clean your meter's case using a damp cloth. **DO NOT** use abrasives, cleaning solvents or strong detergents, as they may damage the finish or affect the reliability of the structural components.

Battery Replacement

Always use a fresh replacement battery of the specified size and type. Immediately remove the old or weak battery from the meter and dispose of it in accordance with your local disposal regulations. Old or defective batteries can leak chemicals that corrode electronic circuits.



WARNING!

To avoid electric shock, be sure to turn off the meter's power and disconnect both test leads from any equipment before you remove or install batteries.

To install a new battery, follow these procedures:

1. Remove the screw from the battery compartment cover on the back of the meter and lift the cover.
2. Remove and discard the old battery. Always dispose of old batteries promptly in a manner consistent with local disposal regulations.



WARNING!

Under **NO** circumstance should you expose batteries to extreme heat or fire as they may explode and cause injury.

3. Place a fresh 9V battery in the compartment.

NOTE: If you do not plan to use the meter for a month or more, remove the battery and store it in an area that won't be damaged by a leaking battery.


4. Reattach the battery compartment cover to the meter and reinstall the screw.

Specifications

Environment conditions	Installation categories II, 600V max. to earth
Pollution degree	2
Altitude	< 2000 m
Operating temperature	0° ~ 40°C (<80% RH)
Storage temperature	-10° ~ 60°C (<70% RH, battery removed)
Max. Voltage between terminals and earth ground	600 V rms
Operating principal	Dual slope integration
Sample rate	2 times/sec for digital data
Display	3-1/2 digits LCD display with max. Reading 1999 Automatic indication of functions and symbols
Range selection	Manual
Over range indication	LCD will display "1". If measure value is over 2000V the LCD will display "1" (AC V & DC V range)
Low battery indication	The "⊕-⊖" is displayed when the battery is under the proper operation range
Power source	DC 3VX3, CR2032
Polarity indication	"-" displayed automatically
Jaw opening diameter	cables 28mm
Maximum conductor size	28mm
Dimensions	194 (L) x 72 (W) x 35 (H) mm
Weight	200g. Approx. (battery included)
Accessories	Manual Test leads Carrying case

Measurement Specifications

*Alignment marks

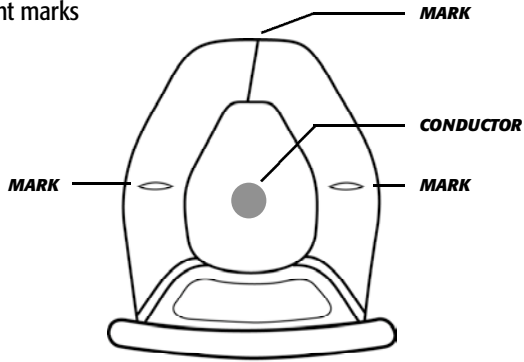

Position the conductor within the jaws at the intersection of the indicated marks as much as possible in order to meet this meter's accuracy specifications.

If the conductor is positioned elsewhere within the jaws, the max. additional error resulted is 1.5%.

*Accuracy: \pm (% of reading + number of digits) at 64° to 82°F (18° to 28°C) with relative humidity to 80%.

AC Current

Range	Resolution	Accuracy
2A	0.001A	$\pm(2\%+5)$
20A	0.01A	
200A	0.1A	

Frequency response: 50/60Hz

DC Voltage

Range	Resolution	Accuracy
600V	1V	$\pm(1\%+5)$

Input impedance: 10M Ω

Maximum input voltage: 600V DC or 600V AC rms

AC Voltage

Range	Resolution	Accuracy
600V	1V	$\pm(1.5\%+5)$

Input impedance: 10M Ω

Frequency response: 40~400Hz

Maximum input voltage: 600V DC or 600V AC rms

Resistance

Range	Resolution	Accuracy
2k Ω	1 Ω	$\pm(1\%+5)$

Open circuit voltage: less than 700mV

Overload protection: 250V DC or 250V AC rms

Audible Continuity

Range	Continuity beeper
$\bullet))$	< approximately 50 Ω

Open circuit voltage: less than 700mV

Overload protection: 250V DC or 250V AC rms

UTL UTL260

Digital Clamp-On Meter

Limited Warranty

The UTL260 is warranted to be free from defects in materials and workmanship for a period of one year from the date of purchase. If within the warranty period your instrument should become inoperative from such defects, the unit will be repaired or replaced at UEi's option. This warranty covers normal use and does not cover damage which occurs in shipment or failure which results from alteration, tampering, accident, misuse, abuse, neglect or improper maintenance. Batteries and consequential damage resulting from failed batteries are not covered by warranty.

Any implied warranties, including but not limited to implied warranties of merchantability and fitness for a particular purpose, are limited to the express warranty. UEi shall not be liable for loss of use of the instrument or other incidental or consequential damages, expenses, or economic loss, or for any claim or claims for such damage, expenses or economic loss. A purchase receipt or other proof of original purchase date will be required before warranty repairs will be rendered. Instruments out of warranty will be repaired (when repairable) for a service charge. Return the unit postage paid and insured to:

1-800-547-5740 • FAX: (503) 643-6322
www.ueitest.com • Email: info@ueitest.com
UTL is distributed by UEi

This warranty gives you specific legal rights. You may also have other rights which vary from state to state.

